

SF Rush the Rock

Field Service Bulletin

U17 Heatsink

It has come to our attention that some **SF Rush the Rock CPU** boards (PN. #'s A-21937) may exhibit a reset problem. Symptoms are: the game freezes then re-boots during game play. To fix this timing error, solder a 10pF 10% axial capacitor (part # 5048-12503-00) from the load side of R571 to the ground side of C310. See below for an exploded view of the exact location on the board of the added capacitor.

